




Instruction Sheet

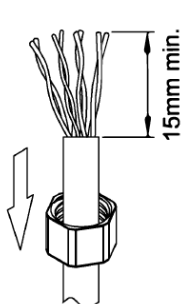


Step 1:
Put cable through the Nut.
(OD:4~6mm;23~26AWG)
Strip the cable for minimum
15 mm,pull the foil or braided
shield back over the jacket.

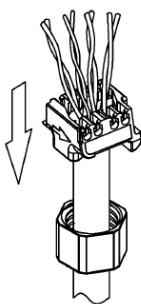

 
Step 2:
Insert the wires into
the cap through the
holes.




Step 3:
Lay the wires
to the correct
positions based
on the color code.
(T568A/T568B)

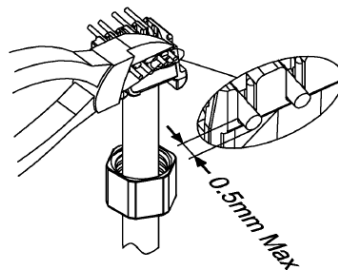


Step 4:
Cut the excess wires off.
The tips of the wires should
protrude no more than
0.5mm.

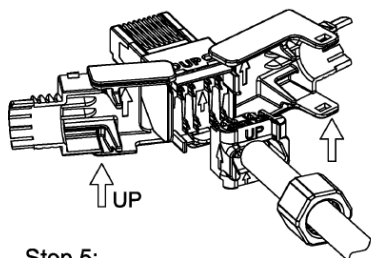

Step 5:
Put the cap on the IDC tower.
The arrows on the jack and the
cap should face the same direction.
Put the cap into position.

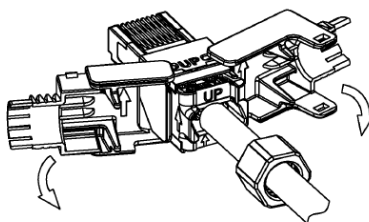


Step 6:
Close the jaws until hearing the click.

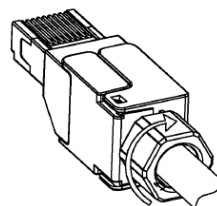


Step 7:
Screw down the nut.

Disassembly Instruction:

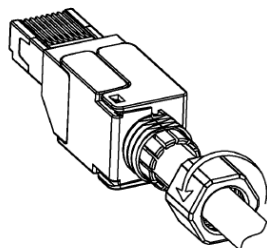

Step 1:
Unscrew the nut.

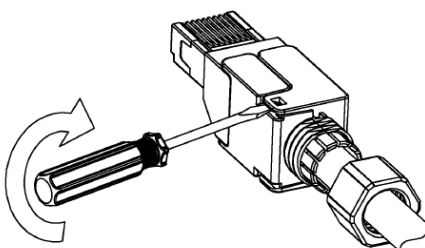

Step 2:
Insert the slotted screwdriver
into the slot and rotate to
open the jaws.

