
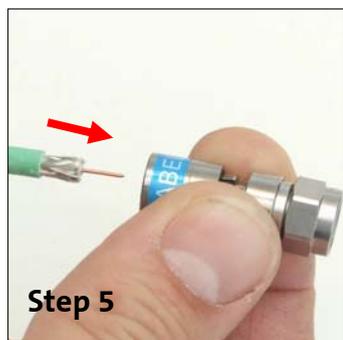
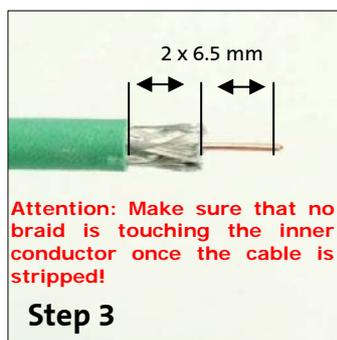


MOUNTING INSTRUCTIONS – CX3 MINI F, IEC & BNC QUICKMOUNT™

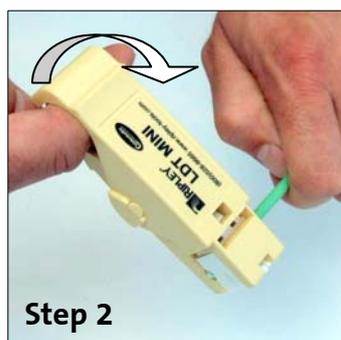

STEP 1: Insert the cable and make sure that the cable is in level with the tool edge (stop) as shown. Please read the instructions supplied with the tools.

STEP 2: Rotate 5-7 times clockwise. Take a solid grip on both tool and the cable. Pull the cable out of the tool without opening the jaws.

STEP 3: This is how the cable should look before installation. Make sure that the stripped area is clean and free of all cut braid. Loose threads can cause short circuits between the braid and inner conductor! For quad shield cables: Remove only the jacket. DO NOT FOLD BACK THE BRAID.

STEP 4: You can use the label to check the stripping dimensions (6.5 mm).

STEP 5: Slide the connector gently on the cable until the PushPin™ is visible as shown on picture 5a to indicate proper installation of the cable. Do not twist the connector during this operation. Make sure that the braid goes nicely into the connector.

For “Feed Through” F-connectors: The inner conductor of the cable will be visible instead of the movable pin shown above (pict. 5a).

STEP 6: Insert the connector/cable in the tool and close the tool handles completely to compress.

Recommended Tools	Item no.
Cable Stripper LDT Mini	98500995
CX3 Pocket Tool RG 6/59 F & IEC	98029070
CX3 Pocket Tool RG 6/59 BNC	98029074
Compression tool CX3 All Size	98029072-01
Compression Tool Multimedia	98029075

Please consult our internet catalogue on www.cabelcon.dk for the latest information on Corning Cabelcon connectors and tools

Distributor:

CABELCON
connectors

Corning Cabelcon ApS, Industriparken 10, DK 4760 Vordingborg
Tel: +45 55 98 55 99 · Fax: +45 55 98 55 04
E-mail: cabelcon@cabelcon.dk · www.cabelcon.dk