



η_{ef} (lm/W)
103-139

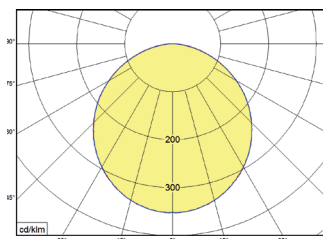

IBP KO

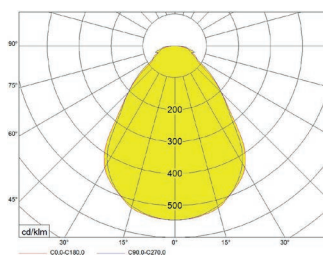

IBP KN

Recessed LED fittings

Body:

White painted (RAL 9016) galvanized metal sheet

Optic:

KO - opal PS cover

KN - microprismatic PS cover

HO - smooth opal PS cover

PCO - opal PC cover

Application:

- Recessed - lighting for installation into false ceiling with visible supporting structure (both 600x600 or 625x625 modules).
- Installation into a gypsum plasterboard ceiling can be done with a QVESTRAM frame.

Versions:

600 – for 600 module

625 – for 625 module

Accessories:

QVESTRAM - a frame for recessed installation into gypsum plasterboard ceiling

LABRAM - a frame for surface installation

VESTRAMA600 – white painted metal frame for recessed installation into gypsum plasterboard ceiling

2200	2700	3000	4000	5700	6500	MIX	RGB	
×	○	○	●	○	○	○	×	×
●	○	○	○	×	×	○	×	○

● default

○ optional


×

not possible



Codes: IBP4000A3KO600ND

IBP	4000	A	3	KO	600	ND
Luminaire type						
Light output						
Body shape		A - square - 600x600 mm C - rectangle - 300x1200 mm				
Color temperature			3 = 3000K, 4 = 4000K, 5 = 5700K			
Cover type:						
KO - opal						
KN - microprizma						
HO - smooth opal PS cover						
PCO - opal PC cover						
Modul						
600						
625						
Driver type:						
ND - no dimmable						
DALI - dimmable DALI						

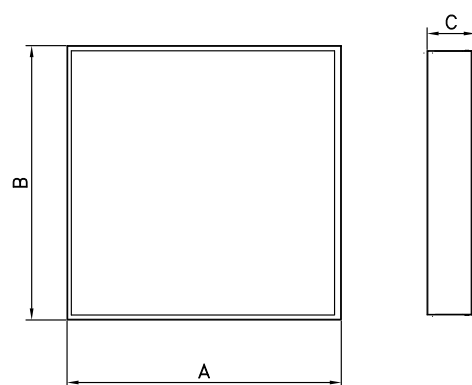

IBP	W	lm		modul 600		modul 625		C	kg
		KO	KN	A	B	A	B		
IBP3000A	23	3 100	3 200	596	596	622	622	90	2,6
IBP4000A	32	4 100	4 200						
IBP5000A	44	5 000	5 100						
IBP6000A	55	6 500	6 900						
IBP2000B	19	1 950	2 050	596	296	x	x		1,9
IBP3000C	23	2 900	3 000	1196	296				2,8
IBP4000C	32	3 900	4 000						
IBP6000C	57	6 500	6 900						

lm – luminaire light output

Due to MODUS program of products development a data can be changed without notice. Luminous flux and connected electrical load are subject to an initial tolerance of up to + / - 10%. Color temperature is subject to a tolerance of up to +/-150 K from the nominal value. The failure of 1 LED points causes no functional impairment to the lighting performance of the luminaire and is therefore no reason for complaint.